



## BIOS Update Release Notes

### PRODUCTS: DB43LD (Standard BIOS)

**BIOS Version 0037 - LDB4310H.86A.0037.2010.1223.1121**

#### About This Release:

- December 23, 2010
- ME Firmware: 5.2.20.1030
- MEBx Code: Based on Version 5.1.0.0019
- Integrated Graphics Option ROM: Build 1940
- LAN Option ROM: Intel(R) Boot Agent PXE GE v1.3.27
- LAN Option ROM: Intel(R) Boot Agent PXE Base Code (PXE-2.1 build 086)

#### New Fixes/Features:

- Fixed issue where Intel® Integrator Toolkit (ITK) file is missing Parallel Port setup item.
- Fixed issue where WLK1.5 TPM TCG OS Interface Test failed.
- Fixed issue where locking "User Access Level" from ITK does not lock the question in Setup.
- Updated ME FW to 5.2.20.1030
- Updated Memory Configuration page in setup to "Mirror".
- Modified Primary Video Adaptor behavior in BIOS setup:
  - Auto: Set priority to PCIEx16, PCIEx1, PCI, IGD
  - Ext PCIe Graphics (PEG): Pick up x1 video if no PCIEx16
- Updated VBIOS to build 1940
- Fixed issue where system does not power on automatically when running iFlash2.

**BIOS Version 0035 - LDB4310H.86A.0035.2009.1125.1944**

#### About This Release:

- November 25, 2009
- ME Firmware: 5.1.10.1175
- MEBx Code: Based on Version 5.1.0.0019
- Integrated Graphics Option ROM: Build 1800
- LAN Option ROM: Intel(R) Boot Agent PXE GE v1.3.27
- LAN Option ROM: Intel(R) Boot Agent PXE Base Code (PXE-2.1 build 086)

#### New Fixes/Features:

- Fixed issue where PS/2 Mouse does not work when a PS/2 keyboard is not attached.
- Implemented Security Phase 2 Patch.
- Modified iQST payload to fix Intel Desktop Utilities issue.
- Changed the default setting of Intel Virtualization Technology to Enabled.
- Fixed issue where after any change is made to any VT-related feature in BIOS, upon exit of BIOS the system will go to S5, then wake and restart.
- Fixed WHQL issue where Signed Driver Check failed.

\*Other names and brands may be claimed as the property of others.

- Fixed POST 51 error when using certain wireless keyboard.
- Added workaround for SCCM SOL hang at CP 50 issue.
- Fixed issue to automatically detect floppy diskette device by SIO GP22.
- Changed CPU FAN DutyCycleMin from 40% to 20%.
- Fixed issue where chassis outlet fan does not update with redetect fans.
- Updated VBIOS to version 1800.
- Fixed issue where S3 resume time is greater than 2 seconds.

## BIOS Version 0032

### About This Release:

- June 29, 2009
- LDB4310H.86A.0032.2009.0729.1146
- ME Firmware: 5.1.10.1175
- MEBx Code: Based on Version 5.1.0.0019
- Integrated Graphics Option ROM: Build 1744
- LAN Option ROM: Intel(R) Boot Agent PXE GE v1.3.27
- LAN Option ROM: Intel(R) Boot Agent PXE Base Code (PXE-2.1 build 086)

### New Fixes/Features:

- Updated Intel® ME firmware to 5.1.10.1175
- Updated MEBX to 5.1.0.0019
- Fixed security requirement issue where system cannot downgrade to previous BIOS.
- Improved BIOS security features.
- Fixed "SMBIOS System Slot Information" and "MOSTEST-Microsoft OEM String" error.
- Fixed Chassis Intrusion Log Only issue.
- Fixed issue where Optical device disable causes Boot Device Priority to show two floppy drives.
- Removed C1E setup items on the Maintenance page.
- Removed TPM setup items on the Maintenance page.
- Fixed issue where low speed 4-wire fan detects incorrectly.
- Fixed BIOS Setup Compliance test failure.
- Fixed issue where S3 fails on Linux platforms.
- Fixed issue where Wake-on-LAN fails after G3 to S5.
- Improved BIOS security feature.
- Fix issue where PATA hard drive information will show at SATA port.
- Fixed issue where floppy drive controller appears in Device Manager.
- Updated iQST feature.
- Updated fonts in POST and Setup.
- Fixed issue where processor and SMBIOS do not display correctly.
- Fixed issue where card reader CF card does not boot properly.
- Fixed issue where when changing Primary Video Adaptor to Int Graphics (IGD) and plugging in a PCI VGA card, the PCI VGA card driver cannot be installed.

## BIOS Version 0030

### About This BIOS:

- April 10, 2009

\*Other names and brands may be claimed as the property of others.

- LDB4310H.86A.0030.2009.0410.1420
- VBIOS Version: 1744
- GBE firmware bin version: 0.5
- PXE Option Rom file: Intel UNDI,PXE-BA1327L2.LOM
- MEBx Version: 5.1.0.0018
- ME Version: 5.1.0.1167

**New Fixes/Features:**

- Initial production BIOS release

---

---

**LEGAL INFORMATION**

---

---

**Information in this document is provided in connection with Intel Products and for the purpose of supporting Intel developed server/desktop boards and systems.**

No license, express or implied, by estoppel or otherwise, to any intellectual property rights is granted by this document. Except as provided in Intel's Terms and Conditions of Sale for such products, Intel assumes no liability whatsoever, and Intel disclaims any express or implied warranty, relating to sale and/or use of Intel products including liability or warranties relating to fitness for a particular purpose, merchantability, or infringement of any patent, copyright or other intellectual property right. Intel Corporation may have patents or pending patent applications, trademarks, copyrights, or other intellectual property rights that relate to the presented subject matter. The furnishing of documents and other materials and information does not provide any license, express or implied, by estoppel or otherwise, to any such patents, trademarks, copyrights, or other intellectual property rights. Intel products are not intended for use in medical, life saving, or life sustaining applications. Intel may make changes to specifications and product descriptions at any time, without notice.

Intel is a trademark of Intel Corporation in the US and other countries.  
Copyright (c) 2011 Intel Corporation.