



BIOS Update Release Notes

PRODUCTS: DG41TY (Standard BIOS)

BIOS Version 0045 - TYG4110H.86A.0045.2010.0706.1910

About This Release:

- July 6, 2010
- Integrated Graphics Option ROM Revision: 1666 PC 14.34
- PXE LAN Option ROM Revision: PXE-2.1 build 082,V2.20,080826

New Fixes/Features:

- Modified password behavior and user access level.

BIOS Version 0044 - TYG4110H.86A.0044.2010.0702.1020

About This Release:

- July 2, 2010
- Integrated Graphics Option ROM Revision: 1666 PC 14.34
- PXE LAN Option ROM Revision: PXE-2.1 build 082,V2.20,080826

New Fixes/Features:

- Modified password behavior and user access level to meet with "BIOS Password Feature Requirements - Rev 0.6".
- Changed Audio Setup option.
- Updated behavior for F10 alternate boot device feature such that when a supervisor password is set, the F10 menu does not display any boot devices that are disabled in BIOS.

BIOS Version 0039 - TYG4110H.86A.0039.2010.0415.1123

About This Release:

- April 15, 2010
- Integrated Graphics Option ROM Revision: 1666 PC 14.34
- PXE LAN Option ROM Revision: PXE-2.1 build 082,V2.20,080826

New Fixes/Features:

- Fixed issue where system hangs while executing the command "itoolkit ext -config" with the parameter of "DEVICE=HIMEM.SYS /testmem:on" in config.sys.
- Fixed issue where a yellow bang shows in Device Manager when using certain PCI Express x16 graphics card.

BIOS Version 0038 - TYG4110H.86A.0038.2010.0301.0950

About This Release:

- March 1, 2010
- Integrated Graphics Option ROM Revision: 1666 PC 14.34
- PXE LAN Option ROM Revision: PXE-2.1 build 082,V2.20,080826

New Fixes/Features:

- Fixed issue where system does not boot after disabling the "Intel Hyper-Threading Technology" setting using Intel® Integrator Toolkit.
- Modified T-segment base address alignment.
- Modified memory page style to mirror in setup.
- Fixed issue where no video is displayed in the operating system with certain graphics cards.

BIOS Version 0037 - TYG4110H.86A.0037.2009.1216.1331

About This Release:

- December 16, 2009
- Integrated Graphics Option ROM Revision: 1666 PC 14.34
- PXE LAN Option ROM Revision: PXE-2.1 build 082,V2.20,080826

New Fixes/Features:

- Implemented Security Phase 2.

BIOS Version 0036 - TYG4110H.86A.0036.2009.1126.2047

About This Release:

- November 26, 2009
- Integrated Graphics Option ROM Revision: 1666 PC 14.34
- PXE LAN Option ROM Revision: PXE-2.1 build 082,V2.20,080826

New Fixes/Features:

- Fixed display warning messages after installing the INI file generated from Intel® Integrator Toolkit.
- Fixed failure of system hangs on code 51 during the POST with certain keyboards.
- Updated CPU cache & MTRR related code to the latest version.
- Enabled the wake function of "EHCI Controller".
- Improved the BBS function.
- Fixed issue with slow boot when using a USB card reader.

BIOS Version 0033

About This Release:

- September 28, 2009
- TYG4110H.86A.0033.2009.0928.1845
- Integrated Graphics Option ROM Revision: 1666 PC 14.34
- PXE LAN Option ROM Revision: PXE-2.1 build 082,V2.20,080826

New Fixes/Features:

- Implemented BIOS downgrade protection.
- Added check for Hotkey before User Password input.
- Fixed LAN PCIHCT failure.
- Updated setup items for fan current information.
- Fixed operating system issue with four 4GB memory modules.
- Changed ACPI _PWR method from "4" to "3" for all USB controllers.

BIOS Version 0031

About This Release:

- June 26, 2009
- TYG4110H.86A.0031.2009.0626.1405
- Integrated Graphics Option ROM Revision: 1666 PC 14.34
- PXE LAN Option ROM Revision: PXE-2.1 build 082,V2.20,080826

New Fixes/Features:

- Fixed issue where locking "User Access Level" from Intel® Integrator Toolkit does not lock the question in Setup.
- Updated setup items related to fan current.
- Added Flash update security.
- Added SMM Mode Security.
- Added security updates for JPEG and BMP decoder.
- Updated SMM module version 4.6.3_SMM_38.
- Fixed failure to suspend to RAM/S3 on Fedora* 10 and Ubuntu* 9.04.
- Fixed LAN in S3 resume issue.
- Added a new setup item "System Fan start up PWM".
- Modified "Chassis Intrusion" item.
- Fixed issues related to Legacy Floppy and USB Flash Drive access from DOS.
- Changed output type of SYSFANOUT from Open-drain to Push-pull.
- Fixed issue where E7600 processor frequency displayed wrong in BIOS.
- Updated F7 BIOS Update Tool.
- Added a new BoardID and created a new thermal profile.
- Fixed issue with processor fan acoustics during early POST.
- Fixed issue where USB Keyboard cannot be used to enter Setup when USB ports are disabled.
- Fixed issue where missing processor SMBIOS info caused WHQL test failures.

BIOS Version 0024

About This BIOS:

- March 24, 2009
- TYG4110H.86A.0024.2009.0324.1324
- VBIOS Build Number: 1666 PC 14.34
- PXE Nahum info: REALTEK RTL8111D-GR Boot Agent PXE Base Code (PXE-2.1 build 082,V2.20,080826)

New Fixes/Features:

- Fixed an issue where the floppy drive would disappear in Microsoft Windows* Vista* after making changes to the BIOS boot menu.
- Fixed an issue where WHQL testing would not complete with certain video adapters.
- Fixed an issue custom BIOS settings could be lost when updating the BIOS using Intel Integrator Toolkit.

BIOS Version 0023

About This BIOS:

*Other names and brands may be claimed as the property of others.

- March 09, 2009
- TYG4110H.86A.0023.2009.0309.1055
- VBIOS info: Build Number: 1666 PC 14.34
- PXE Nahum info: REALTEK RTL8111D-GR Boot Agent PXE Base Code (PXE-2.1 build 082,V2.20,080826)

New Fixes/Features:

- Fixed ACPI error in Windows Event Log.
- Fixed issue where ISO files are not seen when pressing F7 during POST to update the BIOS.
- Fixed issue where the BIOS boot order disappears after pressing F9 with ITKFE modified BIOS.
- Fixed issue with the Need For Speed Game and certain video adapters.

Known Errata:

BIOS Version 0020

About This BIOS:

- December 26, 2008
- TYG4110H.86A.0020.2008.1226.1405
- VBIOS info: Build Number: 1666 PC 14.34
- PXE Nahum info: REALTEK* RTL8111D-GR Boot Agent PXE Base Code (PXE-2.1 build 082,V2.20,080826)

New Fixes/Features:

- Configured registers settings to meet Self-Test 5.19.13.
- Fixed system not reset as setup numeric field changed.
- Set audio front panel default to Enabled.
- Fixed the issue when enabling "UEFI boot", and then pressing F10, system will auto-reset.
- Fixed issue where operating system fails to load when using PCI recovery card.
- Fixed issue where chassis type can't be written by ODMDMI2.
- Fixed issue where some PS/2 keyboards can't wake up system from S3/S4/S5.
- Added patch to decrease POST time.
- Fixed the C-State reported issue.
- Fixed issue where system does not boot with certain graphics card.
- Implemented the chassis type pre-programmed.
- Fixed issue where system won't boot to HDD when Boot Type is set to Advanced.
- Fixed issue where system automatically enters the "BIOS Flash Update" (F7) menu.
- Fixed issue where BIOS setup cannot be entered by pressing "F2" key when using a PS/2 keyboard.
- Fixed issue where memory size evaluation is not correct.

BIOS Version 0018

About This BIOS:

- November 17, 2008

*Other names and brands may be claimed as the property of others.

- TYG4110H.86A.0018.2008.1117.1920
- VBIOS info: Build Number: 1666 PC 14.34
- PXE Nahum info: REALTEK* RTL8111D-GR Boot Agent PXE Base Code (PXE-2.1 build 082,V2.20,080826)

New Fixes/Features:

- Turned off LAN in operating system shutdown path if Wake on LAN from S5 is disabled.
- Fixed auto load default issue after BIOS updating.
- Added support for USB emulation type: size option.
- Fixed the issue that when using the /MD command for Iflash, cannot replace an Intel® Integrator Toolkit custom JPG Splash screen with the Default BIOS Splash Screen.
- Fixed issue where keyboard function key does not work when only attaching a PS/2 keyboard.
- Fixed issue when entering Maintenance Mode, the system Passwords will be uninstalled even though CLEAR ALL PASSWORDS was not selected.
- Implemented the PS/2 port swap function.
- Fixed issue where system cannot shut down and sleep under UEFI Vista*.
- Updated processor support.
- Changed setup default for "Wake on LAN from S5".
- Enabled the Lock thermal interrupt bit in the MSR to fix the error on processor setting.
- Updated for ASPM L0s disable/ un-support.
- Updated the front panel Power LED blink mechanism.
- Modified Chassis type default value in SMBIOS structure.
- Modified EM64T string.
- Fixed issue where the system will hang at check point 0x13 when resume from S3 in SOQM test.
- Updated new board ID definition.
- Fixed issue where pressing F9 key will make language change back to English.
- Updated the algorithm of Hardware Monitor MCH Voltage in setup.

BIOS Version 0016

About this BIOS:

- October 26, 2008
- TYG4110H.86A.0016.2008.1026.2040
- VBIOS info: Build Number: 1666 PC 14.34
- PXE Nahum info: REALTEK* RTL8111D-GR Boot Agent PXE Base Code (PXE-2.1 build 082,V2.20,080826)

New Fixes/Features:

- Initial production BIOS release

LEGAL INFORMATION

Information in this document is provided in connection with Intel Products and for the purpose of supporting Intel developed server/desktop boards and systems.

*Other names and brands may be claimed as the property of others.

No license, express or implied, by estoppel or otherwise, to any intellectual property rights is granted by this document. Except as provided in Intel's Terms and Conditions of Sale for such products, Intel assumes no liability whatsoever, and Intel disclaims any express or implied warranty, relating to sale and/or use of Intel products including liability or warranties relating to fitness for a particular purpose, merchantability, or infringement of any patent, copyright or other intellectual property right. Intel Corporation may have patents or pending patent applications, trademarks, copyrights, or other intellectual property rights that relate to the presented subject matter. The furnishing of documents and other materials and information does not provide any license, express or implied, by estoppel or otherwise, to any such patents, trademarks, copyrights, or other intellectual property rights. Intel products are not intended for use in medical, life saving, or life sustaining applications. Intel may make changes to specifications and product descriptions at any time, without notice.

Intel is a trademark of Intel Corporation in the US and other countries.
Copyright (c) 2010 Intel Corporation.

*Other names and brands may be claimed as the property of others.